



# **SL-T2835IRC100-L210** DATA SHEET

 SPEC. NO.
 :
 SZ19022005

 DATE
 :
 2019/02/20

 REV.
 :
 A/0

Approved By:

Checked By:

Prepared By:

Part No.	SL-T2835IRC100-L210	Page	1 of 9
			LC OD D000 01

# LIGHT



## Features

Pb free product—RoHS compliant Low power consumption, High efficiency

Part No.	SL-T2835IRC100-L210	Page	2 of 9
			LG-QR-R009-01
	<b>^</b>		

-		$\hat{\mathbf{r}}$	 •			
	1	ë ICëM•	~	~		
F		ä l(`äM∙	$\sim$	n	H H v(a)	•
			()			•





#### Absolute Maximum Ratings at Ta=25

Parameter	MAX. Unit		
Power Dissipation	180	mW	
Continuous Forward Current	25	mA	
Peak Forward Current <sup>*2</sup>	100	mA	
Reverse Voltage	5	V	
Electrostatic Discharge (HBM) <sup>*3</sup>	4000	V	
Moisture Sensitivity Level <sup>*1</sup>	5a		
Operating Temperature	-30 to + 85		
Storage Temperature	-40 to + 100		
Reflow Condition	260 MAX for 10 Seconds		

#### 1. Storage

- (1). Storage requirements before vacuum bag opened: Temperature<30 , Humidity<65%RH;
- (2). Check air leakage and vacuum bag damage before opened. If there is any issue found, check the humidity indicator card immediately after bag opened:
  - a. If color changes on "10% circle" of the humidity indicator card only and not the circles of 20% and above, components can be used without additional handling;
  - b. If color changes on both 10% and 20% circles but not the circles of 30% and above, components must be dehumidified according to the conditions of bullet (5);
  - c. If color changes on 10%, 20%, and 30% circle or above, the product should be returned to the supplier for high temperature dehumidification;
- (3). After bag opened, manual soldering or reflow process must follow the following requirements:
  - a. Complete soldering / reflow within 24 hours;
  - b. Requirements of working environment: Temperature<30 , Humidity<60%RH;
- (4). If the working condition is outside (3)a requirement, the components must be dehumidified according to the conditions of bullet (5);
- (5). Low temperature dehumidification: temperature 60-65 , at least 24 hours;
- (6). Shelf life: 30 days. If it's over 30 days from the production date on the package label, the components must be dehumidified according to the condition of bullet (5). If customer is unable to dehumidify, return components to LIGHT for dehumidification.

#### 2. Peak Forward Current:

Condition for is IFP pulse Pulse Width 100 us and duty 1%.

#### 3. Caution in ESD:

Static Electricity and surge damages the LED. It is recommend to use a wrist band or anti-electrostatic glove when handling the LED. All devices, equipment and machinery must be properly grounded.

# LIGHT




#### Electrical Optical Characteristics at Ta=25

Parameter	Symbol	Min.	Тур.	Max.	Unit	Test Condition
Radiant Flux	Ро	25	27	29	mW/sr	I <sub>F</sub> =100mA <sup>*2</sup>
Viewing Angle(X)	0		60		Dag	$I_{F}=100 mA^{*1}$
Viewing Angle(Y)	<b>2</b> 1/2		60		Deg.	$I_{\rm F}=100{\rm mA}$
Peak Wavelength	р		940		nm	I <sub>F</sub> =100mA
Spectral Line Half- Width			50		nm	I <sub>F</sub> =100mA
Forward Voltage	$V_{\mathrm{F}}$	1.3	1.5	1.8	V	I <sub>F</sub> =100mA
Reverse Current	I <sub>R</sub>			10	μA	V <sub>R</sub> =5V

#### Note:

- 1.  $_{1/2}$  is the off-axis angle at which the Radiant Intensity is half the axial Radiant Intensity.
- 2. The Po guarantee should be added  $\pm 15\%$  tolerance.

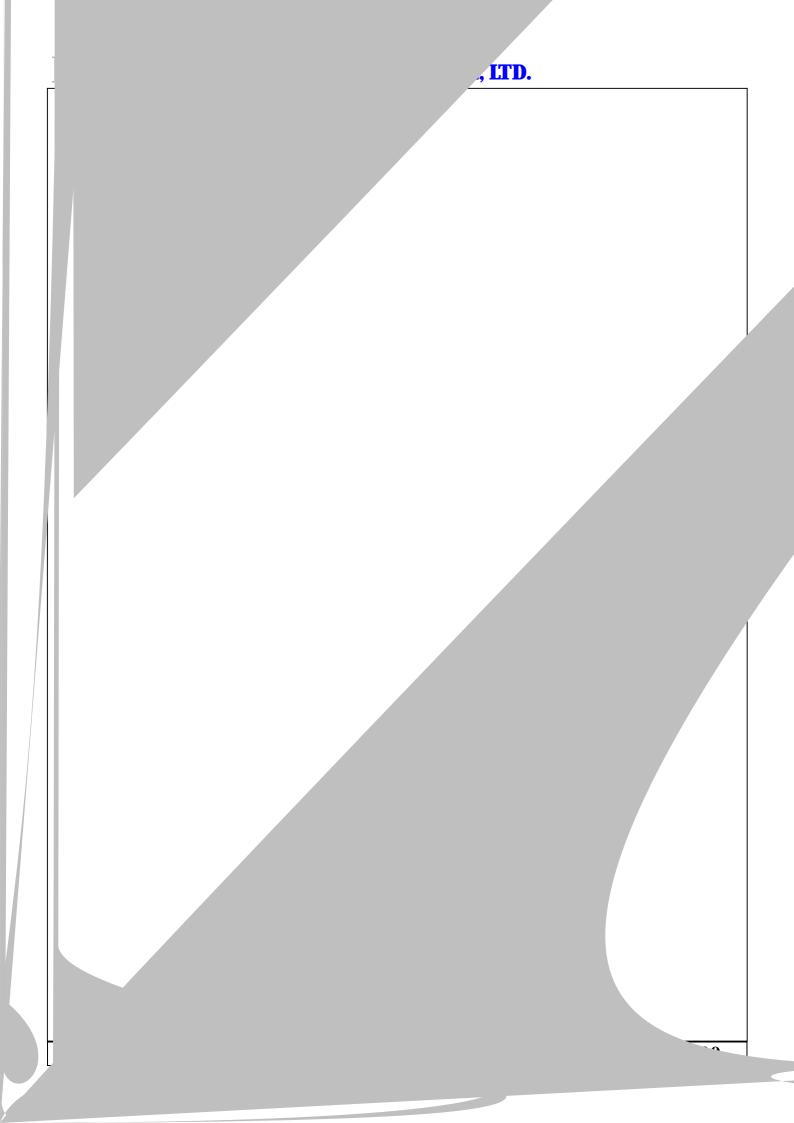

## LIGHT ELECTEI 32GH ELECTEI 32GH ELE2 54






Part No.

# LIGHT ELECTRONICS CO., LTD.



### Label Explanation

CLIANTI TY:	NODEL NAME:_	
	quanti Ty: _	Б С
	BIN_	
	Packing Date: _	
RENARKS:	REMARKS:	

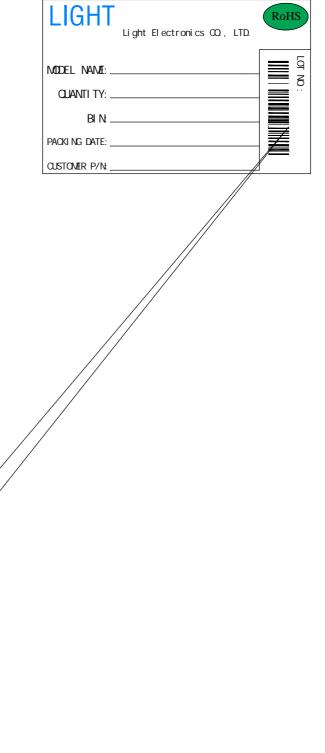

SL-T2835IRC100-L210	Page	7 of 9
		IC OD DOOD





### Carrier Tape Specifications (Loaded Quantity: 2000pcs/reel)




Part No.	SL-T2835IRC100-L210	Page	8 of 9





### Suggest IR Reflow Condition For Lead Free

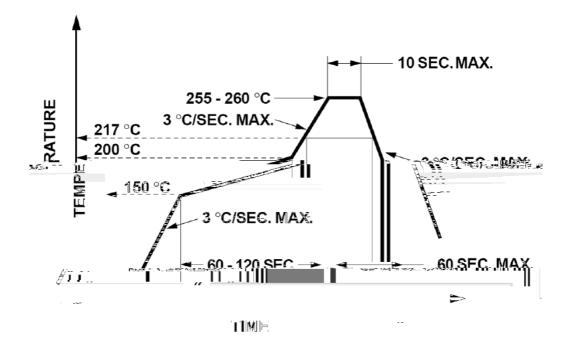

- 1. Reflow soldering should not be done more than two times.
- 2. When soldering, do not put stress on the LEDs during heating.

#### Soldering iron

- 1. When hand soldering, the temperature of the iron must less than 300 for 3 seconds.
- 2. The hand solder should be done only once.

#### Repairing

Repair should not be done after the LEDs have been soldered. When repairing is unavoidable, a double-head soldering iron should be used (as below figure). It should be confirmed beforehand whether the characteristics of LEDs will or will not be damaged by repairing.

